


Tension Gauge Calibration Chart

Bandsaw Gauges

Gauge Diameter (ft)	Indicator Reading (inch)		
	Distance Between Pins (inch)		
	5.000	7.000	9.000
30	0.0174	0.0340	0.0563
35	0.0149	0.0292	0.0482
40	0.0130	0.0255	0.0422
45	0.0116	0.0227	0.0375
50	0.0104	0.0204	0.0338
55	0.0095	0.0186	0.0307
60	0.0087	0.0170	0.0281
65	0.0080	0.0157	0.0260
70	0.0074	0.0146	0.0241
75	0.0069	0.0136	0.0225
80	0.0065	0.0128	0.0211
85	0.0061	0.0120	0.0199
90	0.0058	0.0113	0.0188
95	0.0055	0.0107	0.0178
100	0.0052	0.0102	0.0169
105	0.0050	0.0097	0.0161
110	0.0047	0.0093	0.0153
115	0.0045	0.0089	0.0147
120	0.0043	0.0085	0.0141

Circle Saw Gauges

RPM Gauge	Gauge Diameter (ft)	5.000	7.000	9.000
1200	90	0.0058	0.0113	0.0188
1100	105	0.0050	0.0097	0.0161
1000	125	0.0042	0.0082	0.0135
900	145	0.0036	0.0070	0.0116
800	175	0.0030	0.0058	0.0096
700	220	0.0024	0.0046	0.0077
600	280	0.0019	0.0036	0.0060
500	375	0.0014	0.0027	0.0045
400	525	0.0010	0.0019	0.0032
300	850	0.0006	0.0012	0.0020
200	1600	0.0003	0.0006	0.0011

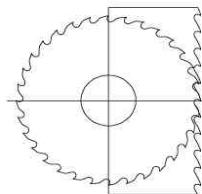

TKT Engineering Inc.

13485 16th Avenue
 Surrey, BC V4A 1P6
 Canada
 Tel. 604-880-1705
 Fax. 604-648-8012
www.thinkerf.com